

Manhole Inspection Summary

Manhole # S07QQ1031MH

Printed On: 1/29/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **07QQ1** Node: **031** Status: **Found**

Insp Date: **5/3/07 11:28 AM**

Incomplete Comments

Crew: **ADS**
Inspector: **ADS1**
Firm: **ADS**

Location Address: **5206 NPARK HEIGHTS AVE** Cross Street: **BELVEDERE AVE**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **Sheeting**

Comments

Cover Shape: **Circular** Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
75

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **5** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☒ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☒ Parged

Shape: **Circular** Diameter: **36** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☒ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☒ **Leaks** ☐ Debris

Channel Material: **Brick** ☒ Parged

Channel Exposure: **Fully Open** Junc Dist: **2** nearest .5 ft. Azimuth: **180**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **8** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S07QQ1031MH

Printed On: 1/29/2009

Page 2 of 3

Location View



Top View



Top View




Defect 3



INFILTRATION BENCH- LOCATION UNKNOWN

Defect 2

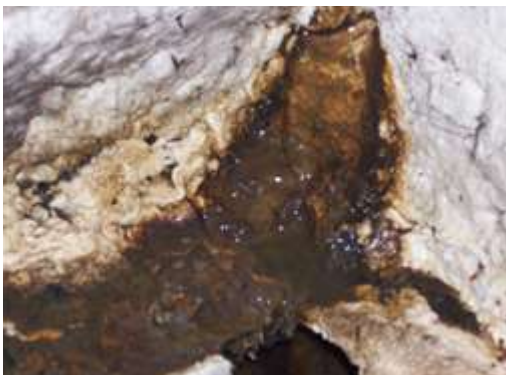

BENCH INFILTRATION - RUNNER

Defect 3



CORRODED STEPS

Manhole Inspection Summary

Manhole # S07QQ1031MH

Printed On: 1/29/2009

Page 3 of 3

15 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: (in.) Direct
Pipe Material: **PVC** ☐ Pipe Lined
Invert Depth: **13.59** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

15 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: (in.) Direct
Pipe Material: **PVC** ☐ Pipe Lined
Invert Depth: **13.52** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection